







Alert #: SA 17-17 **Date:** 10/17/17

Genie OPA Assembly Reinforcement

GIS has received a notice from OSHA that Genie has determined that the Operator's Protective Alarm (OPA) installed on any of the models listed on page 6 of the Safety Notice is equipped with a mounting bracket that may become loose. This may cause the OPA assembly to fall off the machine resulting in a collision hazard.





Actions Required:

- See attached Safety Notice for affected models/serial numbers.
- If you have any of these machines in your workforce please follow the instructions on the Safety Notice Attached.

Report all incidents immediately to the GIS Hotline 1-855-543-5163.



Safety Notice

Mandatory Action Required

170004

North America



Date: September 22, 2017

Affected Option: Operator Protective Alarm (OPA)

Models and Serial Numbers Affected: See pages 4 to 6

Field Install Kits Affected: 125563 - for all Z-45/25 DC models

1255096 and 1276063 - for machines equipped with ALC500

operating system

1255564 and 1273064 - for machines equipped with ALC1000

operating system.

Subject: Operator Protective Alarm (OPA) mounting

Allowable Hours: 1 hour

Issue:

Genie has determined that the Operator's Protective Alarm (OPA) installed on any of the models listed on page 6 is equipped with a mounting bracket that may become loose. **This may cause the OPA assembly to fall off the machine resulting in a collision hazard.**

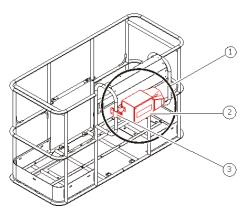


Illustration 1

- 1 OPA Assembly
- 2 OPA Control Box Assembly
- 3 Mounting Bracket



Safety Notice

Mandatory Action Required

170004

Genie

North America

Action(s) Required:

This Safety Notice requires installing a reinforcement structure around the OPA assembly.

- 1 Locate the machines where the affected OPA assemblies were installed within your fleet.
- 2 Locate the OPA assembly and inspect the mounting bracket.

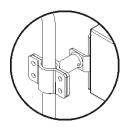


Illustration 2

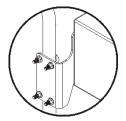


Illustration 3

Silver mounting bracket

Black mounting bracket

3 Using the table below, determine the OPA kit part number to order for your OPA assembly.

Table 1 - OPA Kit to order

Mounting Bracket Type	Kit Part Number		
Silver mounting bracket	1275550GT		
Black mounting bracket	1277210GT		

4 Install the kit on the affected OPA assembly.

Completion of this Safety Notice must take place as soon as possible, but no later than 30 days from receipt of the kit.

Fill out and sign the completion form included in this Safety Notice or attached to the installation instructions included in the kit and fax or email to Terex AWP Warranty Department. This will serve as verification that you have completed Safety Notice 170004.



Safety Notice

Mandatory Action Required

170004

North America



Continued Use Instructions:

All machine operators and users must be notified of these continued use requirements.

You may continue using the OPA assembly with the machine. However, the OPA assembly must be removed from the machine before transport. Re-install the OPA assembly at the worksite.

Note: Perform this procedure on a firm, level surface with the machine in the stowed position.

1 Locate the OPA harness connectors (items 1 and 2).



Illustration 4

- 1 harness connector 1 (tape switch)
- 2 harness connector 2 (platform control box or footswitch)
- 3 blanking plug (Genie part number 1255030GT)
- 2 Disconnect harness connector 1 from the red OPA control box. Secure the harness.
- 3 Disconnect harness connector 2 from the platform control box or footswitch. Secure the harness.
- 4 Locate the blanking plug (Genie part number 1255030GT) from the machine document box and plug into the platform or footswitch connector where harness connector 2 was removed.
 - Note: The machine will not function if this connection is not plugged.
- 5 Disconnect the mounting bracket from the platform. Refer to illustrations 2 and 3 on page 2.
 - Note: Make sure to keep the mounting fasteners.
- 6 Set the red OPA control box on the platform and secure with a suitable tie down.

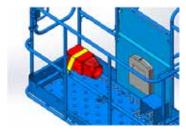


Illustration 5



Safety Notice

Mandatory Action Required

170004

North America



Models and Serial Numbers Affected:

Machines equipped with the OPA option shipped from the factory within the following models and serial ranges:

S- Booms

Model	Serial Number	Model	Serial Number
S-40:	S4016H-22271 to 22992	S-80X:	S80X15-12809 to 12809
	S40H-23501 to 23507		S80X16H-13425 to 13778
S-45:	S4514-19235 to 19793	S-85:	S8016D-186 to 304
	S4515-20522 to 21728		S85D-340 to 443
	S4516-21900 to 21908		S8513-10539 to 10539
	S4516H-21969 to 22991		S8514-11075 to 11774
	S45H-23540 to 23746		S8515-12657 to 13171
			S8516H-13404 to 13777
S-60X:	S60X16N-31267 to 31279		S85H-14003 to 14070
	S60X16H-35249 to 36162		
	S60XH-36502 to 36592	S-105:	S10516D-1391
S-60 / S-65:	S6014A-27677 to 28862	S-125:	S12513D-553 to 612
	S6015A-29739 to 31084		S12514D-907 to 908
	S6015D-202 to 330		S12515D-1065 to 1305
	S6016D-395 to 630		S12516D-1353 to 1472
	S60D-640 to 794		
	S6015H-35025 to 35030	SX-135XC:	SX135H-113 to 125
	S6016H-35036 to 36160		
	S60H-36400 to 36610	SX-150:	SX15016H-197 to 227
	S6016M-103 to 195		
	S60M-400 to 486	SX-180:	SX-18014-141:
	S6016N-31323 to 31356		SX-18015-210 to 275
			SX-18016H-320 to 352
S-65TRAX:	S60TXD-654 to 850		SX-180H-601
	S60TX16H-35874 to 36161		



Safety Notice

Mandatory Action Required

170004

North America



Z- Booms

Model	Serial Number	Model	Serial Number
Z-45/25:	Z452514A-51329 to 52779 Z-62:		Z6215A-112 to 846
	Z452515A-53296 to 55001		Z6216A-967
	Z452516A-55090 to 55104		Z6216D-108 to 136
	Z452514B-3656 to 4265		Z62D-150 to 197
	Z452515B-4283 to 5375		Z62H-3004 to 3059
	Z452516B-5421 to 5433		Z6216M-101 to 102
	Z45216D-750 to 773		Z62M-405 to 540
	Z452516D-708 to 912		Z6216N-1091 to 2034
	Z4525D-963 to 1243		
	Z452516M-5455 to 6415	Z-80:	Z8014-4823 to 5204
	Z4525M-6700 to 7191		Z8015-5309 to 5749
	Z452516N-55302 to 56865		Z8016-5776 to 5777
	Z4525N-57202 to 57355		Z8016H-5876 to 6208
			Z80H-6400 to 6515
Z-51:	Z513015B-1496 to 1507		
	Z513016M-1647 to 1706	ZX-135:	ZX13513-2222 to 2229
	Z5130M-2014 to 2120		ZX13514-2482 to 2483
			ZX13515-2557 to 2783
Z-60:	Z6014-13514 to 14265		ZX13516H-2813 to 2973
	Z60H-705 to 724		ZX135H-3202 to 3246
	Z6016N-210 to 400		
	Z60N-640 to 640		



Safety Notice

Mandatory Action Required

170004

North America



Models Affected:

The OPA Assembly can be installed in the following models.

S- Boom Models Z- Boom Models

 S-40
 Z-45/25 IC

 S-45
 Z-45/25 J IC

 S-40Trax
 Z-45/25 DC

 S-45Trax
 Z-45/25 J DC

 S-60
 Z-45/25 Bi-Energy

 S-65
 Z-45/25J Bi-Energy

S-60XZ-51/30S-60XCZ-60/34S-60TraxZ-60/37 DCS-65TraxZ-60/37 FES-80Z-62/40S-85Z-80/60S-80XZ-135/70

S-105 S-120 S-125

S-100

SX-135 XC

SX-150

SX-180

To order parts:

Machine owners with a valid Genie account can contact the Terex AWP Parts Department to place an order through one of the following:

Genie Website:

https://www.gogenielift.com/default.aspx

ZX-135/70

Fax: 1-888-274-6192 Phone: 1-800-536-1800

Machine owners without a valid Genie account can contact their nearest Terex AWP dealership or Terex AWP Service Centers for assistance.

Search for your nearest Terex AWP dealership by visiting our website at:

http://www.genielift.com/dealersearch/



Safety Notice

Mandatory Action Required

170004

North America



Warranty:

The labor and travel miles required to perform this Safety Notice are covered under the provisions of our LIMITED PRODUCT WARRANTY statement. Warranty claims can be submitted online, by paper claims, fax or email. If you need more information about filing a warranty claim, please contact Terex AWP Warranty Department at:

Email (North America): AWP.Warranty@terex.com
Email (Asia-Pacific): warranty.awpchina@terex.com
Email (Brazil): AWP.Warrantybrazil@terex.com
Email (all others): AWP.Warranty@terex.com

United States: + 1-800-536-1800
Canada: + 1-425-881-1800
Asia-Pacific: + 86-21-347028555
Brazil: + 0-800-031-0100
South America (except Brazil): + 56-9-6431-2110
All other locations: + 1-425-881-1800

Genie and local industry standards (e.g. ANSI, CSA) requires that the seller of a Genie machine report to Genie the model and serial number of each machine sold, as well as the name, address, and telephone number of the new owner, within 60 days of the sale. Use the Owner Update Form attached to the bulletin to indicate the new location or status of any of your machines. You may also visit our website to register your machine.

Machine Registration_ANSI http://www.genielift.com/en/service-support/product-registration/index.htm

Genie, OSHA and local industry standards, also require that the manufacturer's Safety Notice be completed. It is your responsibility to communicate this important information to all machine owners and applicable branches. If you require additional copies of this Safety Notice or have any questions, please contact Genie Product Support at:

United States: + 1-800-536-1800
Canada: + 1-425-881-1800
Asia-Pacific: + 86-21-347028555
Brazil: + 0-800-031-0100
South America (except Brazil): + 56-9-6431-2110
All other locations: + 1-425-881-1800

Enclosures:

- Customer Machine List
- New Owner Update Form
- Completion Form



Safety Notice 170004

New Owner Update Form

(for updating machine owner information only)

Genie and ANSI requires that the seller of a Genie machine report to Genie the model and serial number of each machine sold, as well as the name, address, and telephone number of the new owner, within 60 days of the sale.

• If you have sold a machine, list new owner's name, address and phone number, for each machine. List complete model and serial number (ex. S6015A-29739, S80X16H-13576, S12515D-1279, Z452516M-5481, Z8016H-6127)

	1	Machine 1	М	achine 2	Machine 3
Model*			-		
Serial Nu	mber *		- -	_	
Owner Na	ame*				
Address	 1*				
Address 2	2				
City/State	e/Zip*			_	
Phone Nu	umber*				
Contact F	Person				
* Require	ed fields				
Sallar Inf	formation:				
	iormation.				
Date:	. Nomes				
Company Account 7	/ Name:			<u> </u>	
Address:	<i>-</i>			<u> </u>	
(street):					
(city):					
(state, zip	. code) .			_	
State, zip Phone #:				_	
110110 #1	·				
•	List any machines	that could not be	inspected or re	paired because of the	e following:
Model & :	Serial Number	Scrapped	Exported	Stolen	Other (explain)
			-	-	-
		. —			-
					-
				-	-
		1 077 720 752	<u></u>	Latin America:	+ 55 11 3246-9760
Fax to:	United States	1 8 / / - / 38 - / 23			
Fax to:	United States: Canada:	1 877-738-753 1 425-498-753			
Fax to:	United States: Canada: Mexico:	1 425-498-753 1 425-498-753	0	Central America: Asia-Pacific:	+ 1 425 498 7530 + 1 425 498 7530



Safety Notice 170004

Completion Form

Your signature on this form will verify that you have completed Safety Notice 170004 on the machines listed below.

Please note that this is not a Warranty Claim Form. A Warranty Claim Form must be submitted to the Terex AWP Warranty Department for reimbursement under the provisions of our standard warranty terms and conditions

terms an	d conditions.				
Fax to:					
	United States:	1 877-738-7530	United Kingdom:	+ 44 1476 584 334	
	Canada:	1 425-498-7530	France:	+ 33 237 260 998	
	Australia:	+ 61 733751002	Germany:	+ 49 4221 491 820	
	Latin America:	+55 11 3246-9760	Italy:	+ 39 075 941 8146	
	Central America:	+ 1 425 498 7530	Iberica:	+ 34 935 725 080	
	Carribean:	+ 1 425 498 7530	Scandinavia:	+ 46 3157 5104	
	Mexico:	+ 1 425 498 7530	Middle East:	+ 97 143 990 382	
	Asia-Pacific:	+ 1 425 498 7530	All other location	s: + 31 165 510 826	
	All other locations:	+ 1 425 498 7530			
Email to:	AWP.Warranty@tere	ex.com			
Date:					
Company	v Name:				
	# (if applicable):				
Address:	X 2 F F 2 2 2 7				
(street):					
(city):					
(state, zip	code):				
Phone:					
Z452516	st the complete machin M-5481, Z8016H-6127 e one that applies to yo		5A-29739, S80X16H	-13576, S12515D-1279,	
			OPA Assembly		
1	Model	Serial Number	Factory Installed Fie	eld Installed / Invoice Number	
		_		\Box /	
	· · · · · · · · · · · · · · · · · · ·				
				□ / □ /	
				□ / □ /	
				□ /	
7			Ш	□ <i>I</i>	
Print (ser	vice manager)	Signature		Date	